

## **VEGAMET 841**

# Controller in field housing for a continuously measuring analogue level sensor



#### **Application area**

The VEGAMET 841 controller feeds the connected 4 ... 20 mA sensor, processes the measured values and displays them. A large display for data visualisation is integrated in the housing designed for rough field conditions

It enables simple implementation of pump controls, flow measurements on open channels and weirs and totalizers. With the VEGAMET 841, limit values can be reliably monitored and relays can be switched, e.g. for an overfill protection according to WHG.

Due to its various possibilities it is suitable for many industrial branches.

## Your benefit

- Easy-to-read display from a distance, even in sunlight and darkness
- · Complex programming of control tasks is no longer necessary
- Simple and reliable commissioning and diagnosis of the measuring points via smartphone

## **Function**

The VEGAMET 841 controller can power the connected sensor and process its measurement signals. The requested parameter is shown on the display and also output to the integrated current output for further processing. The measurement signal can thus be transferred to a remote display or a superordinate control system. Operating relays for control of pumps or other devices are also integrated.

#### **Approvals**

Worldwide approvals are available for VEGA instruments, e.g. for use in hazardous areas, on ships or in hygienic applications.

The technical data in the respective safety instructions are valid for approved instruments (e.g. with Ex approval). In some cases, these data can differ from the data listed herein.

You can find detailed information on the existing approvals with the appropriate product on our homepage.

#### **Technical data**

Operating voltage

- Nominal voltage AC 100 ... 230 V (-15 %, +10 %) 50/60 Hz

- Nominal voltage DC 24 ... 65 V (-15 %, +10 %)

Power consumption max. 13 VA; 4 W

Sensor input

Number of sensors 1 x 4 ... 20 mA

Type of input (selectable)

Active inputPassive inputSensor supply through VEGAMET 841Sensor has an own voltage supply

Measured value transmission

- 4 ... 20 mA analogue for 4 ... 20 mA sensors

Relay output

Quantity 3 x operating relay, one can be configured

as fail safe relay

Contact Floating change-over contact (SPDT)

Switching voltage max. 250 V AC/60 V DC

Switching current max. 1 A AC (cos phi > 0.9), 1 A DC
Breaking capacity min. 50 mW, max. 250 VA, max. 40 W D

min. 50 mW, max. 250 VA, max. 40 W DC (with U < 40 V DC)

Current output

Quantity 1 x output

Range 0/4 ... 20 mA, 20 ... 0/4 mA

Max. load 500  $\Omega$ 

Bluetooth interface

Bluetooth standard Bluetooth 5.0

## **Indicators**

Measured value indication

- Graphic-capable LC 89 x 56 mm, digital and quasianalogue

display, with lighting display

Adjustment elements 4 x keys for menu adjustment

**Ambient conditions** 

Ambient temperature

- Instrument in general  $-40 \dots +60 \,^{\circ}\text{C} \, (-40 \dots +140 \,^{\circ}\text{F})$ 

– Display (readability) –20  $\dots$  +60 °C (-4  $\dots$  +140 °F)

Electrical protective measures

Protection rating IP66/IP67 acc. to IEC 60529, Type 4X acc.

to UL 50



## **Adjustment**

The VEGAMET 841 has an integrated display and adjustment unit. In addition, the parameter adjustment of the device can be done via Bluetooth and corresponding adjustment tools.

## Adjustment via the display and adjustment unit

The adjustment is carried out menu-driven via four front keys and a clearly arranged, graphic-capable display with backlight.

#### Wireless adjustment via Bluetooth


The integrated Bluetooth module enables wireless connection to smart-phones/tablets (iOS/Android) or Windows PCs.

Operation is via a free app from the "Apple App Store", the "Google Play Store" or the "Baidu Store". Alternatively, adjustment can also be carried out via PACTware/DTM and a Windows PC.



Wireless connection to smartphone/table/notebook

#### **Electrical connection**

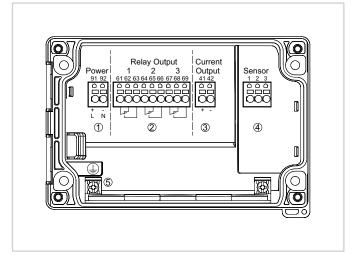


Wiring plan VEGAMET 841

- 1 Voltage supply of the controller
- 2 Relay outputs 1 ... 3
- 3 Current output
- 4 Sensor input (active/passive)
- 5 Ground terminal for protective conductor

Details on the electrical connection can be found in the operating instructions of the device in the download area on our homepage.

# Specification sheet

## **Dimensions**

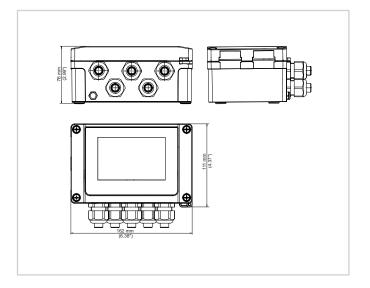

#### Information

You can find further information on the VEGA product line on our homepage.

In the download section of our homepage you'll find operating instructions, product information, industry brochures and approval documents as well as device and adjustment software.

#### Contact

You can find your personal contact person at VEGA on our homepage under "Contact".